



July 10, 2017

CITY OF SASKATOON

Asbestos-Containing Building Materials Assessment Report - Archibald Arena



Submitted to:

The City of Saskatoon
1101 Avenue P North
Saskatoon, SK S7L 7K6

Report Number: 1667963

Distribution:

One Copy: City of Saskatoon
One Copy: Golder Associates Ltd.

REPORT





Table of Contents

1.0 INTRODUCTION.....	1
2.0 SCOPE OF WORK	1
2.1 Asbestos-Containing Materials	1
3.0 RESULTS AND DISCUSSION	2
3.1 Asbestos-Containing Materials	2
3.1.1 List of Identified Asbestos-Containing Materials	2
3.1.2 Non Asbestos-Containing Materials	3
4.0 EXCLUDED AREAS AND MATERIALS	3
5.0 CONCLUSIONS AND RECOMMENDATIONS.....	4
5.1 Asbestos-Containing Materials	4
6.0 SURVEY LIMITATIONS.....	5
7.0 CLOSURE.....	5

APPENDICES

APPENDIX A

Laboratory Certificate of Analysis Report

APPENDIX B

Site Photographs

APPENDIX C

Room by Room Spreadsheet

APPENDIX D

Floor Plans



1.0 INTRODUCTION

Golder Associates Ltd. (Golder) was retained by the City of Saskatoon (the Client) to conduct an asbestos-containing building materials assessment of the Archibald Arena (the Site) located at 1410 Windsor Street in Saskatoon, Saskatchewan. This assessment report details our findings, conclusions and recommendations for the Site. A walkthrough of the Site was conducted on April 19, 2017 and the assessment was conducted on June 1, 2017 by Kody Henderson, OHS Project Manager. Asbestos-containing building materials were identified within the Archibald Arena during the assessment. Further information is provided in Section 3.0.

2.0 SCOPE OF WORK

In accordance with Tender 16-0844, Golder's scope of work included conducting an asbestos-containing building materials assessment of the Site to evaluate the quantities, locations, and conditions of asbestos-containing building materials.

Following the field work, Golder prepared this assessment report that includes laboratory analysis results, findings of the assessment, conclusions, and recommendations.

2.1 Asbestos-Containing Materials

The assessment involved a non-destructive inspection of the Site to assess the type and extent of suspect ACMs in the facility. The systems that were reviewed as part of the inspections included, but were not limited to:

- *Structural* - systems including: insulation between solid webbed joists, fireproofing, building envelope, and interior/exterior caulking around windows and doors;
- *Mechanical* - systems insulation including: hot water and steam system, condensate system, chilled water system, glycol system, domestic hot and cold water, emergency generator exhaust, boiler units, heat exchangers, and asbestos cement piping; and
- *Architectural* - systems including: texture coats, sheet flooring, vinyl floor tile, acoustical spray-applied materials, condensation control applications, ceiling tile, wall board, drywall joint compound, and asbestos sheet products.

Systematic sampling of suspect ACMs was conducted as part of the assessment. Samples were submitted under chain of custody to International Asbestos Testing Laboratory Inc. (IATL) and analyzed for asbestos type and percentage content using Polarized Light Microscopy (PLM) in accordance with EPA methodologies (EPA 600/R-93/116).

Further information related to the assessment and sample collection methods can be found in the Golder document *Golder Asbestos Assessment General Survey Plan and Protocol* provided to the Client.



3.0 RESULTS AND DISCUSSION

The Archibald Arena was constructed in 1972 and consists of change rooms, offices spaces, washrooms, mechanical rooms, and a rink on the main floor along with mechanical and storage rooms on the mezzanine. Based upon information provided by the Site Contact, Rooms 122 to 129 were added to the building in approximately 1990. During the assessment, Rooms 122 to 129 were treated as one functional space, the remaining main floor change rooms, offices, and rink as a second functional space, and the mezzanine as a third functional space.

- The Laboratory Certificate of Analysis report for the bulk asbestos samples is included in Appendix A.
- Photographs collected during the assessment are provided in Appendix B.
- A room by room spreadsheet outlining the locations, quantities, friability, and condition of identified asbestos-containing materials as well as additional information is provided in Appendix C.
- A floor plan outlining the sample locations and locations of identified asbestos-containing materials is provided in Appendix D.
- Please refer to Sections 4.0 and 6.0 of this report for a summary of the limitations encountered.

3.1 Asbestos-Containing Materials

A total of twenty-eight (28) samples of building materials were collected and tested for asbestos content during the assessment of the Archibald Arena. One (1) of the samples was found to contain asbestos.

3.1.1 List of Identified Asbestos-Containing Materials

A list of the identified asbestos-containing materials is below.

- Black Door Window Caulking (exterior doors).

Further information on the list of identified asbestos-containing materials listed is provided below.

Black Door Window Caulking

One (1) sample of black door window caulking was collected during the assessment. The sample collected was found to contain trace Chrysotile asbestos. Asbestos-containing black door window caulking (see Photograph 1 in Appendix B) was observed in the following locations:

- Exterior Doors (approximately 15 linear ft).

Please note the asbestos-containing caulking was found on the exterior of the door windows along Room 101. The caulking located on the interior of the door windows was sampled and was found to not contain asbestos.



3.1.2 Non Asbestos-Containing Materials

The following materials were sampled during this assessment and were found to not contain asbestos or were observed to be a non-suspect materials:

- Black door window caulking (interior);
- White building caulking;
- White duct mastic;
- Drywall joint compound;
- 2'x4' Ceiling tile with widthwise fissures;
- Concrete scratch coat (interior and exterior);
- Red firestop;
- White sink undercoat;
- Grey duct mastic;
- Cement panels;
- Green building caulking;
- The drain lines throughout the site were not observed to have suspect packing;
- The duct work throughout the site was observed to be uninsulated or insulated with fibreglass insulation;
- The duct connector fabric throughout the site is not suspected to contain asbestos due to the vintage of construction; and
- The piping throughout the site was observed to be insulated with fibreglass and had PVC fittings.

4.0 EXCLUDED AREAS AND MATERIALS

The following is a list of the areas and/or materials excluded during the assessment.

- Floor levelling compound was not encountered at the time of the assessment. If floor levelling compound is encountered during renovation or demolition activities, additional sampling should be conducted to evaluate the presence or absence of asbestos.
- Building materials accessible by a ten foot ladder were assessed by Golder during the assessment. Materials located at heights that were inaccessible from a ten foot ladder were not assessed. If materials at heights are to be removed or impacted by future renovation or demolition activities, additional investigation and sampling of suspect materials may be required.
- The roof and associated components were not assessed by Golder during the assessment as per Tender 16-0844. If the roof and associated components are to be removed or impacted by future renovation or demolition activities, additional investigation and sampling of suspect materials may be required.



ASBESTOS-CONTAINING BUILDING MATERIALS ASSESSMENT REPORT - ARCHIBALD ARENA

- Golder was unable to access Room 104 during the assessment as the room was locked and the Site Contact did not have keys. If work activities are scheduled within this area, further sampling may be required. If building materials within Room 104 are to be removed or impacted by future renovation or demolition activities, additional investigation and sampling of suspect materials may be required.
- Golder assessed the exterior metal cladding for potential asbestos-containing materials where possible. Due to the potential to affect the building envelope, the metal cladding was not impacted or removed to assess below. If the metal cladding is to be removed or impacted by future renovation or demolition activities, additional investigation and sampling of suspect materials may be required.

5.0 CONCLUSIONS AND RECOMMENDATIONS

Based on the visual assessment and the laboratory analytical results, the following project specific conclusions and recommendations are provided.

5.1 Asbestos-Containing Materials

Asbestos was positively identified within the black door window caulking along the exterior of the doors within Room 101 of the Site. Asbestos was not identified in the remaining samples collected and analyzed.

If the building is scheduled for renovations that will impact the identified asbestos-containing materials, it must be removed. If additional suspect asbestos-containing building materials are encountered during renovation activities, additional sampling should be undertaken to evaluate asbestos content.

Removal work should be completed by workers that are adequately trained in the hazards and proper methods of working with asbestos. Throughout the abatement activities, appropriate air monitoring and inspections should be conducted by a competent person to document that contamination is contained and that ACM are disposed of appropriately. Ensure asbestos waste is disposed of in accordance with the requirements of the Government of Saskatchewan.

All quantities listed in the report are approximate and are based on the conditions at the time of the assessment. Prior to abatement work it is recommended that a competent person conduct a review of the site to quantify and obtain all measurements of all building materials detailed in this report for cost estimating purposes.

In anticipation of potential abatement, Golder's recommendations for the asbestos-containing materials identified during the assessment are outlined below.

Black Door Window Caulking

If scheduled for impact, asbestos-containing black door window caulking should be abated following low-risk abatement work procedures as outlined in the *Saskatchewan Asbestos Abatement Manual* (2017). Alternatively, as the black door window caulking was observed in good condition, and with a priority rating of 5 (please see the room by room spreadsheet provided in Appendix C for a description of the priority ratings), it can be managed in place if not scheduled for impact.



6.0 SURVEY LIMITATIONS

This report is based on data and information collected by Golder during the assessment conducted on June 1, 2017 and is based solely on site conditions encountered at the time of the assessment. Any use of this document or the findings, conclusions or recommendations provided in this report by any person other than the City of Saskatoon is at the sole risk of such user.

The conclusions and recommendations contained in this survey report are based upon professional opinions with regard to the subject matter. These opinions are in accordance with currently accepted environmental assessment standards and practices applicable to these locations and are subject to the following inherent limitations:

The data and findings presented in this report are valid as of the dates of the investigations. The passage of time, manifestation of latent conditions or occurrence of future events may warrant further exploration at the properties, analysis of the data, and re-evaluation of the findings, observations, and conclusions expressed in this report. No assurance is made regarding changes in conditions or practices subsequent to the time of the investigation. It was beyond the scope of this assessment to conduct a risk assessment and the potential health risks that may be associated with asbestos exposure for building occupants.

The data reported and the findings, observations and conclusions expressed in this report are limited by the Scope of Work. The Scope of Work was defined by Tender 16-0844 and the initial site walkthrough with the Client, the time and budgetary constraints imposed by the Client, and availability of access to the property.

Because of the limitations stated above, the findings, observations and conclusions expressed by Golder in this report are not, and must not be, considered an opinion concerning compliance of any past or present owner or operator of the site with any federal, provincial or local laws or regulations.

No warranty or guarantee, whether expressed or implied, is made with respect to the data or the reported findings, observations, and conclusions, which are based solely upon site conditions in existence at the time of investigation.

Golder's assessment reports present professional opinions and findings of a scientific and technical nature. While attempts were made to relate the data and findings to applicable environmental laws and regulations, the report shall not be construed to offer legal opinion or representations as to the requirements of, nor compliance with, environmental laws, rules, regulations or policies of federal, provincial, or local governmental agencies. Any use of the survey report constitutes acceptance of the limits of Golder's liability.

Golder's liability extends only to its client and not to other parties who may obtain this survey report. Issues raised by the report must be reviewed by appropriate legal counsel.

7.0 CLOSURE

We trust the information presented in this report meets your requirements. If you have any questions please contact Kody Henderson at (780) 483-3499 or email at kody_henderson@golder.com. Thank you for the opportunity to be of service. We look forward to working with you again in the future.



ASBESTOS-CONTAINING BUILDING MATERIALS ASSESSMENT REPORT - ARCHIBALD ARENA

Report Signature Page

GOLDER ASSOCIATES LTD.

Prepared by:

Kody Henderson, Dipl. Env. Sci., CRSP
OHS Project Manager

Reviewed by:

Andrew Grant, B.Sc., P.Eng., EP, CRSP
Associate, OHS Project Director

KH/AG/ba

Golder, Golder Associates and the GA globe design are trademarks of Golder Associates Corporation.

\\golder\galliedmonton\active\2016\3 proj\1667963 cityofsaskatoon_asbsurveys_saskatoon\07 reports\06 - archibald arena\city of saskatoon - archibald arena - asbestos building material assessment report.docx



APPENDIX A

Laboratory Certificate of Analysis Report

CERTIFICATE OF ANALYSIS

Client: Golder Associates Ltd
16820 107 Ave
Edmonton AB T5P 4C3

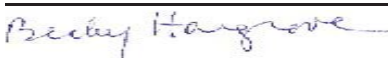
Report Date: 6/14/2017
Report No.: 538140 - PLM
Project: Asbestos Surveys – City of Saskatoon, Archibald Arena
Project No.: 1667963


Client: GOL572

PLM BULK SAMPLE ANALYSIS SUMMARY

Lab No.: 6256223 Client No.: A-001 <u>Percent Asbestos:</u> <i>None Detected</i>	Description: Black Putty Facility: <u>Percent Non-Asbestos Fibrous Material:</u> None Detected	Location: Room 101 <u>Percent Non-Fibrous Material:</u> 100
Lab No.: 6256224 Client No.: A-002 <u>Percent Asbestos:</u> <i>None Detected</i>	Description: White Caulk Facility: <u>Percent Non-Asbestos Fibrous Material:</u> None Detected	Location: Room 101 <u>Percent Non-Fibrous Material:</u> 100
Lab No.: 6256225 Client No.: A-003 <u>Percent Asbestos:</u> <i>None Detected</i>	Description: Grey Mastic Facility: <u>Percent Non-Asbestos Fibrous Material:</u> None Detected	Location: Room 102 <u>Percent Non-Fibrous Material:</u> 100
Lab No.: 6256226 Client No.: A-004 <u>Percent Asbestos:</u> <i>None Detected</i>	Description: White Joint Compound Facility: <u>Percent Non-Asbestos Fibrous Material:</u> None Detected	Location: Room 102 <u>Percent Non-Fibrous Material:</u> 100
Lab No.: 6256227 Client No.: A-005 <u>Percent Asbestos:</u> <i>None Detected</i>	Description: White Joint Compound Facility: <u>Percent Non-Asbestos Fibrous Material:</u> None Detected	Location: Room 107 <u>Percent Non-Fibrous Material:</u> 100
Lab No.: 6256228 Client No.: A-006 <u>Percent Asbestos:</u> <i>None Detected</i>	Description: White Joint Compound Facility: <u>Percent Non-Asbestos Fibrous Material:</u> None Detected	Location: Room 106 <u>Percent Non-Fibrous Material:</u> 100

Analytical Method -US EPA 600, R93-116. Please refer to the Appendix of this report for further information regarding your analysis.

Date Received: 6/7/2017
Date Analyzed: 06/14/2017
Signature: 
Analyst: Rebecca Hargrove

Approved By: 
Frank E. Ehrenfeld, III
Laboratory Director

CERTIFICATE OF ANALYSIS

Client: Golder Associates Ltd
16820 107 Ave
Edmonton AB T5P 4C3

Report Date: 6/14/2017
Report No.: 538140 - PLM
Project: Asbestos Surveys – City of Saskatoon, Archibald Arena
Project No.: 1667963

Client: GOL572

PLM BULK SAMPLE ANALYSIS SUMMARY

Lab No.: 6256229	Description: Grey/White Ceiling Tile; 2x4	Location: Room 103
Client No.: A-007	Facility:	
<u>Percent Asbestos:</u> <i>None Detected</i>	<u>Percent Non-Asbestos Fibrous Material:</u> 80 Cellulose Trace Fibrous Glass	<u>Percent Non-Fibrous Material:</u> 20

Lab No.: 6256230	Description: Grey/White Ceiling Tile; 2x4	Location: Room 103
Client No.: A-008	Facility:	
<u>Percent Asbestos:</u> <i>None Detected</i>	<u>Percent Non-Asbestos Fibrous Material:</u> 80 Cellulose Trace Fibrous Glass	<u>Percent Non-Fibrous Material:</u> 20

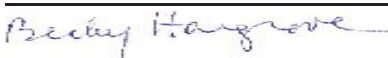
Lab No.: 6256231	Description: Grey/White Ceiling Tile; 2x4	Location: Room 103
Client No.: A-009	Facility:	
<u>Percent Asbestos:</u> <i>None Detected</i>	<u>Percent Non-Asbestos Fibrous Material:</u> 80 Cellulose Trace Fibrous Glass	<u>Percent Non-Fibrous Material:</u> 20

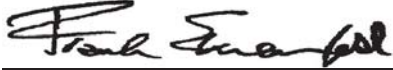
Lab No.: 6256232	Description: Grey Plaster	Location: Room 106A
Client No.: A-010	Facility:	
<u>Percent Asbestos:</u> <i>None Detected</i>	<u>Percent Non-Asbestos Fibrous Material:</u> Trace Cellulose	<u>Percent Non-Fibrous Material:</u> 100

Lab No.: 6256233	Description: Grey Plaster	Location: Room 106
Client No.: A-011	Facility:	
<u>Percent Asbestos:</u> <i>None Detected</i>	<u>Percent Non-Asbestos Fibrous Material:</u> Trace Cellulose	<u>Percent Non-Fibrous Material:</u> 100

Lab No.: 6256234	Description: Grey Plaster	Location: Room 106
Client No.: A-012	Facility:	
<u>Percent Asbestos:</u> <i>None Detected</i>	<u>Percent Non-Asbestos Fibrous Material:</u> None Detected	<u>Percent Non-Fibrous Material:</u> 100

Analytical Method -US EPA 600, R93-116. Please refer to the Appendix of this report for further information regarding your analysis.

Date Received: 6/7/2017
Date Analyzed: 06/14/2017
Signature: 
Analyst: Rebecca Hargrove

Approved By: 
Frank E. Ehrenfeld, III
Laboratory Director

CERTIFICATE OF ANALYSIS

Client: Golder Associates Ltd
16820 107 Ave
Edmonton AB T5P 4C3

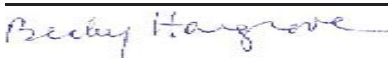
Report Date: 6/14/2017
Report No.: 538140 - PLM
Project: Asbestos Surveys – City of Saskatoon, Archibald Arena
Project No.: 1667963


Client: GOL572

PLM BULK SAMPLE ANALYSIS SUMMARY

Lab No.: 6256235 Client No.: A-013	Description: Red Caulk Facility:	Location: Room 106
<u>Percent Asbestos:</u> <i>None Detected</i>	<u>Percent Non-Asbestos Fibrous Material:</u> None Detected	<u>Percent Non-Fibrous Material:</u> 100
Lab No.: 6256236 Client No.: A-014	Description: Grey Caulk Facility:	Location: Room 127
<u>Percent Asbestos:</u> <i>None Detected</i>	<u>Percent Non-Asbestos Fibrous Material:</u> None Detected	<u>Percent Non-Fibrous Material:</u> 100
Lab No.: 6256237 Client No.: A-015	Description: Off-White Insulation Facility:	Location: Room 127
<u>Percent Asbestos:</u> <i>None Detected</i>	<u>Percent Non-Asbestos Fibrous Material:</u> 20 Cellulose	<u>Percent Non-Fibrous Material:</u> 80
Lab No.: 6256238 Client No.: A-016	Description: Grey Caulk Facility:	Location: Room 128
<u>Percent Asbestos:</u> <i>None Detected</i>	<u>Percent Non-Asbestos Fibrous Material:</u> None Detected	<u>Percent Non-Fibrous Material:</u> 100
Lab No.: 6256239 Client No.: A-017	Description: White Joint Compound Facility:	Location: Room 200
<u>Percent Asbestos:</u> <i>None Detected</i>	<u>Percent Non-Asbestos Fibrous Material:</u> None Detected	<u>Percent Non-Fibrous Material:</u> 100
Lab No.: 6256240 Client No.: A-018	Description: Grey Mastic Facility:	Location: Room 200
<u>Percent Asbestos:</u> <i>None Detected</i>	<u>Percent Non-Asbestos Fibrous Material:</u> None Detected	<u>Percent Non-Fibrous Material:</u> 100

Analytical Method -US EPA 600, R93-116. Please refer to the Appendix of this report for further information regarding your analysis.

Date Received: 6/7/2017
Date Analyzed: 06/14/2017
Signature: 
Analyst: Rebecca Hargrove

Approved By: 
Frank E. Ehrenfeld, III
Laboratory Director

CERTIFICATE OF ANALYSIS

Client: Golder Associates Ltd
16820 107 Ave
Edmonton AB T5P 4C3

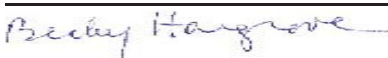
Report Date: 6/14/2017
Report No.: 538140 - PLM
Project: Asbestos Surveys – City of Saskatoon, Archibald Arena
Project No.: 1667963


Client: GOL572

PLM BULK SAMPLE ANALYSIS SUMMARY

Lab No.: 6256241 Client No.: A-019	Description: White Joint Compound Facility:	Location: Room 201
<u>Percent Asbestos:</u> <i>None Detected</i>	<u>Percent Non-Asbestos Fibrous Material:</u> None Detected	<u>Percent Non-Fibrous Material:</u> 100
Lab No.: 6256242 Client No.: A-020	Description: White Joint Compound Facility:	Location: Room 201
<u>Percent Asbestos:</u> <i>None Detected</i>	<u>Percent Non-Asbestos Fibrous Material:</u> None Detected	<u>Percent Non-Fibrous Material:</u> 100
Lab No.: 6256243 Client No.: A-021	Description: White Joint Compound Facility:	Location: Room 202
<u>Percent Asbestos:</u> <i>None Detected</i>	<u>Percent Non-Asbestos Fibrous Material:</u> None Detected	<u>Percent Non-Fibrous Material:</u> 100
Lab No.: 6256244 Client No.: A-022	Description: White Joint Compound Facility:	Location: Room 202
<u>Percent Asbestos:</u> <i>None Detected</i>	<u>Percent Non-Asbestos Fibrous Material:</u> None Detected	<u>Percent Non-Fibrous Material:</u> 100
Lab No.: 6256245 Client No.: A-023	Description: Grey Cementitious Facility:	Location: Exterior
<u>Percent Asbestos:</u> <i>None Detected</i>	<u>Percent Non-Asbestos Fibrous Material:</u> None Detected	<u>Percent Non-Fibrous Material:</u> 100
Lab No.: 6256246 Client No.: A-024	Description: Grey Cementitious Facility:	Location: Exterior
<u>Percent Asbestos:</u> <i>None Detected</i>	<u>Percent Non-Asbestos Fibrous Material:</u> None Detected	<u>Percent Non-Fibrous Material:</u> 100

Analytical Method -US EPA 600, R93-116. Please refer to the Appendix of this report for further information regarding your analysis.

Date Received: 6/7/2017
Date Analyzed: 06/14/2017
Signature: 
Analyst: Rebecca Hargrove

Approved By: 
Frank E. Ehrenfeld, III
Laboratory Director

CERTIFICATE OF ANALYSIS

Client: Golder Associates Ltd
16820 107 Ave
Edmonton AB T5P 4C3

Report Date: 6/14/2017
Report No.: 538140 - PLM
Project: Asbestos Surveys – City of Saskatoon, Archibald Arena
Project No.: 1667963

Client: GOL572

PLM BULK SAMPLE ANALYSIS SUMMARY

Lab No.: 6256247
Client No.: A-025

Description: Grey Cementitious
Facility:

Location: Exterior

Percent Asbestos:
None Detected

Percent Non-Asbestos Fibrous Material:
None Detected

Percent Non-Fibrous Material:
100

Lab No.: 6256248
Client No.: A-026

Description: Grey Cementitious
Facility:

Location: Exterior

Percent Asbestos:
None Detected

Percent Non-Asbestos Fibrous Material:
None Detected

Percent Non-Fibrous Material:
100

Lab No.: 6256249
Client No.: A-027
Percent Asbestos:
PC Trace Chrysotile

Description: Black Caulk
Facility:
Percent Non-Asbestos Fibrous Material:
None Detected

Location: Exterior Door Window
Percent Non-Fibrous Material:
100

Lab No.: 6256250
Client No.: A-028

Description: Lt. Yellow Caulk
Facility:
Percent Non-Asbestos Fibrous Material:
None Detected

Location: Exterior
Percent Non-Fibrous Material:
100

Analytical Method -US EPA 600, R93-116. Please refer to the Appendix of this report for further information regarding your analysis.

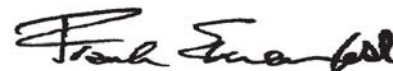
Date Received: 6/7/2017

Date Analyzed: 06/14/2017

Signature:

Analyst: Rebecca Hargrove

Approved By:



Frank E. Ehrenfeld, III
Laboratory Director

CERTIFICATE OF ANALYSIS

Client: Golder Associates Ltd
16820 107 Ave
Edmonton AB T5P 4C3

Report Date: 6/14/2017
Report No.: 538140 - PLM
Project: Asbestos Surveys – City of Saskatoon, Archibald Arena
Project No.: 1667963

Client: GOL572

Appendix to Analytical Report

Customer Contact:

Analysis: US EPA 600, R93-116

This appendix seeks to promote greater understanding of any observations, exceptions, special instructions, or circumstances that the laboratory needs to communicate to the client concerning the above samples. The information below is used to help promote your ability to make the most informed decisions for you and your customers. Please note the following points of contact for any questions you may have.

iATL Customer Service: customerservice@iatl.com

iATL Office Manager: cdavis@iatl.com

iATL Account Representative: Pete Lesniak

Sample Login Notes: See Batch Sheet Attached

Sample Matrix: Bulk Building Materials

Exceptions Noted: See Following Pages

General Terms, Warrants, Limits, Qualifiers:

General information about iATL capabilities and client/laboratory relationships and responsibilities are spelled out in iATL policies that are listed at www.iATL.com and in our Quality Assurance Manual per ISO 17025 standard requirements. The information therein is a representation of iATL definitions and policies for turnaround times, sample submittal, collection media, blank definitions, quantification issues and limit of detection, analytical methods and procedures, sub-contracting policies, results reporting options, fees, terms, and discounts, confidentiality, sample archival and disposal, and data interpretation.

iATL warrants the test results to be of a precision normal for the type and methodology employed for each sample submitted. iATL disclaims any other warrants, expressed or implied, including warranty of fitness for a particular purpose and warranty of merchantability. iATL accepts no legal responsibility for the purpose for which the client uses test results. Any analytical work performed must be governed by our Standard Terms and Conditions. Prices, methods and detection limits may be changed without notification. Please contact your Customer Service Representative for the most current information.

This confidential report relates only to those item(s) tested and does not represent an endorsement by NIST-NVLAP, AIHA LAP LLC, or any agency of local, state or province governments nor of any agency of the U.S. government.

This report shall not be reproduced except in full, without written approval of the laboratory.

Information Pertinent to this Report:

Analysis by US EPA 600 93-116: Determination of Asbestos in Bulk Building Materials by Polarized Light Microscopy (PLM).

Certifications:

- NIST-NVLAP No. 101165-0
- NY-DOH No. 11021
- AIHA-LAP, LLC No. 100188

Quantification at <0.25% by volume is possible with this method. (PC) Indicates Stratified Point Count Method performed. (PC-Trace) means that asbestos was detected but is not quantifiable under the Point Counting regimen. Analysis includes all distinct separable layers in accordance with EPA 600 Method. If not reported or otherwise noted, layer is either not present or the client has specifically requested that it not be analyzed (ex. analyze until positive instructions). Small asbestos fibers may be missed by PLM due to resolution limitations of the optical microscope. Therefore, PLM is not consistently reliable in detecting asbestos in non-friable organically bound (NOB) materials. Quantitative transmission electron microscopy (TEM) is currently the only method that can pronounce materials as non-asbestos containing.

Analytical Methodology Alternatives: Your initial request for analysis may not have accounted for recent advances in regulatory requirements or advances in technology that are routinely used in similar situations for other qualified projects. You may have the option to explore additional analysis for further information. Below are a few options, listed as the matrix followed by the appropriate methodology. Also included are links to more information on our website.

Bulk Building Materials that are Non-Friable Organically Bound (NOB) by Gravimetric Reduction techniques employing PLM and TEM: ELAP 198.6 (PLM-NOB), ELAP 198.4 (TEM-NOB)

Loose Fill Vermiculite Insulation, Attic Insulation, Zonolite (copyright), etc.: US EPA 600 R-4/004 (multi-tiered analytical process)
Sprayed On Insulation/Fireproofing with Vermiculite (SOF-V): ELAP 198.8 (PLM-SOF-V)>

Soil, sludge, sediment, aggregate, and like materials analyzed for asbestos or other elongated mineral particles (ex. erionite, etc.): ASTM D7521, CARB 435, and other options available

CERTIFICATE OF ANALYSIS

Client: Golder Associates Ltd
16820 107 Ave
Edmonton AB T5P 4C3

Report Date: 6/14/2017
Report No.: 538140 - PLM
Project: Asbestos Surveys – City of Saskatoon, Archibald Arena
Project No.: 1667963

Client: GOL572

Asbestos in Surface Dust according to one of ASTM's Methods (very dependent on sampling collection technique – by TEM): ASTM D 5755, D5756, or D6480

Various other asbestos matrices (air, water, etc.) and analytical methods are available.

Disclaimers / Qualifiers:

There may be some samples in this project that have a "NOTE:" associated with a sample result. We use added disclaimers or qualifiers to inform the client about something that requires further explanation. Here is a list with highlighted disclaimers that may be pertinent to this project. For a full explanation of these and other disclaimers, please inquire at customerservice@iatl.com.

- 1) Note: No mastic provided for analysis.
- 2) Note: Insufficient mastic provided for analysis.
- 3) Note: Insufficient material provided for analysis.
- 4) Note: Insufficient sample provided for QC reanalysis.
- 5) Note: Different material than indicated on Sample Log / Description.
- 6) Note: Sample not submitted.
- 7) Note: Attached to asbestos containing material.
- 8) Note: Received wet.
- 9) Note: Possible surface contamination.
- 10) Note: Not building material. 1% threshold may not apply.
- 11) Note: Recommend TEM-NOB analysis as per EPA recommendations.
- 12) Note: Asbestos detected but not quantifiable.
- 13) Note: Multiple identical samples submitted, only one analyzed.
- 14) Note: Analyzed by EPA 600/R-93/116. Point Counting detection limit at 0.080%.
- 15) Note: Analyzed by EPA 600/R-93/116. Point Counting detection limit at 0.125%.

Recommendations for Vermiculite Analysis:

Several analytical protocols exist for the analysis of asbestos in vermiculite. These analytical approaches vary depending upon the nature of the vermiculite mineral being tested (e.g. un-processed gangue, homogeneous exfoliated books of mica, or mixed mineral composites). Please contact your client representative for pricing and turnaround time options available.

iATL recommends initial testing using the EPA 600/R-93/116 method. This method is specifically designed for the analysis of asbestos in bulk building materials. It provides an acceptable starting point for primary screening of vermiculite for possible asbestos.

Results from this testing may be inconclusive. EPA suggests proceeding to a multi-tiered analysis involving wet separation techniques in conjunction with PLM and TEM gravimetric analysis (EPA 600/R-04/004).

Further information on this method and other vermiculite and asbestos issues can be found at the following: Agency for Toxic Substances and Disease Registry (ATSDR) www.atsdr.cdc.gov, United States Geological Survey (USGS) www.minerals.usgs.gov/minerals/, US EPA www.epa.gov/asbestos. The USEPA also has an informative brochure "Current Best Practices for Vermiculite Attic Insulation" EPA 747F03001 May 2003, that may assist the health and remediation professional.

The following is a summary of the analytical process outlines in the EPA 600/R-04/004 Method:

- 1) **Analytical Step/Method:** Initial Screening by PLM, EPA 600R-93/116
Requirements/Comments: Minimum of 0.1 g of sample. ~0.25% LOQ for most samples.
- 2) **Analytical Step/Method:** Wet Separation by PLM Gravimetric Technique, EPA R-04/004
Requirements/Comments: Minimum 50g** of dry sample. Analysis of "Sinks" only.
- 3) **Analytical Step/Method:** Wet Separation by PLM Gravimetric Technique, EPA R-04/004
Requirements/Comments: Minimum 50g** of dry sample. Analysis of "Floats" only.
- 4) **Analytical Step/Method:** Wet Separation by TEM Gravimetric Technique, EPA R-04/004
Requirements/Comments: Minimum 50g** of dry sample. Analysis of "Sinks" only.
- 5) **Analytical Step/Method:** Wet Separation by TEM Gravimetric Technique, EPA R-04/004
Requirements/Comments: Minimum 50g** of dry sample. Analysis of "Suspension" only.

LOQ, Limit of Quantitation estimates for mass and volume analyses.

*With advance notice and confirmation by the laboratory.

**Approximately 1 Liter of sample in double-bagged container (~9x6 inch bag of sample).



APPENDIX B

Site Photographs



APPENDIX B

Site Photographs



Photograph 1: Asbestos-Containing Black Door Window Caulking.

\\golder\gall\edmonton\active\2016\3 proj\1667963 cityofsaskatoon_asbsurveys_saskatoon\07 reports\06 - archibald arena\appendix b - site photographs.docx



APPENDIX C

Room by Room Spreadsheet

Appendix A
Archibald Arena
ACM Inventory[illegible]

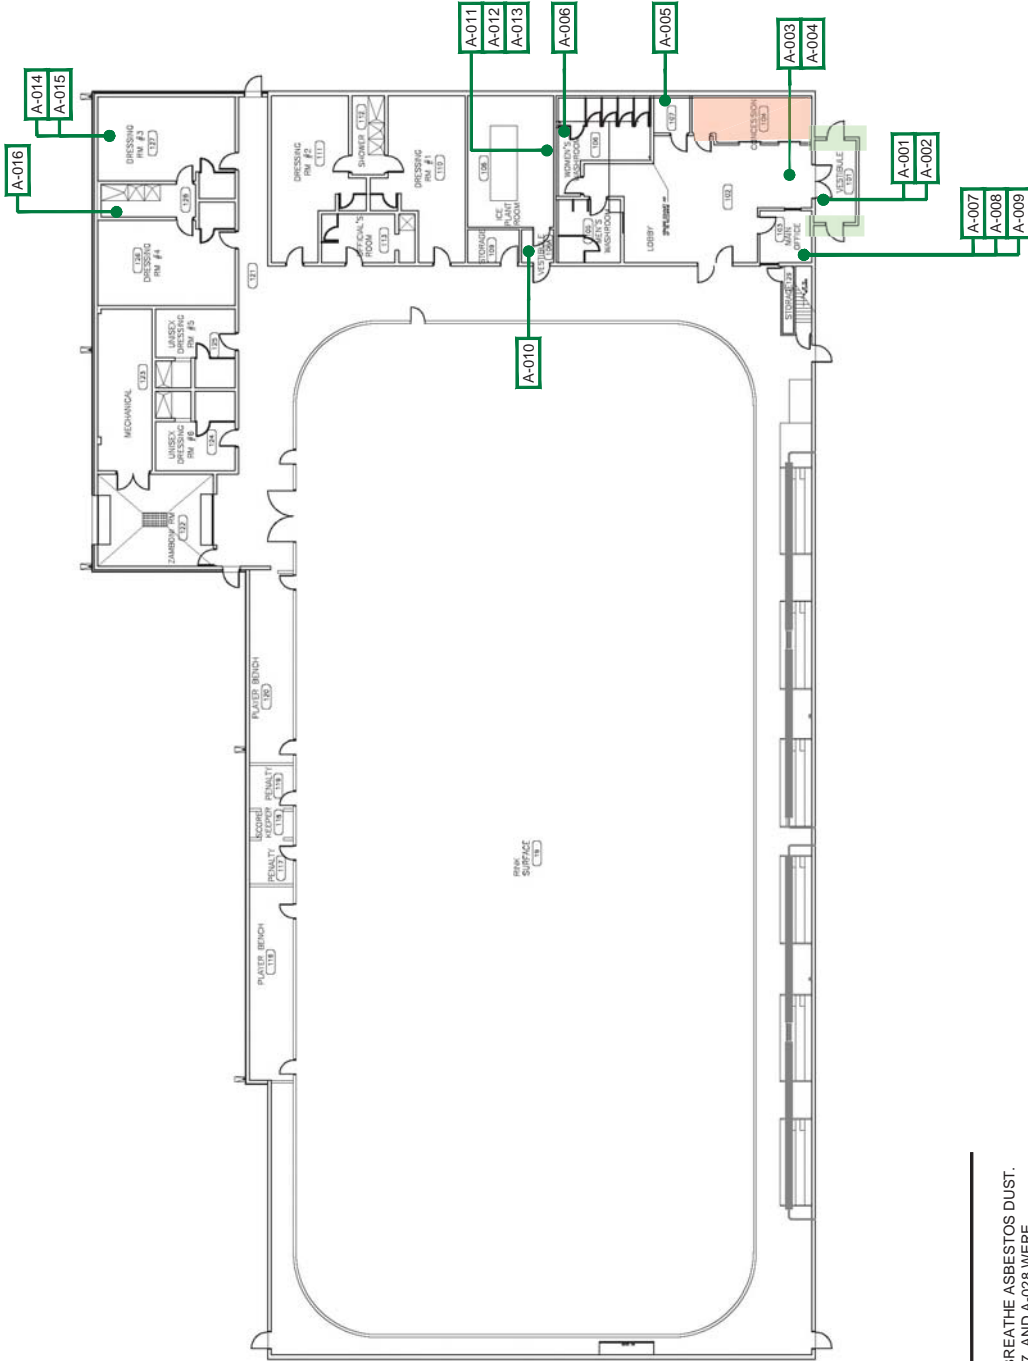
Appendix A
Archibald Arena
ACM Inventory

Floor	Room #	Area Description	Subelement	Material Description	Accessibility	Subject?	Abuse Containing Material?	Condition	Field Note	Sample Type	Sample ID	Substrate Type	ACM Product	% of asbestos	Friable	Sparged on	Maintenance	Inspection	Priority	Reliable for Disturbance	Recommended Action	Quantity	Photograph ID	Labeling Type
1st Floor	M 124	Entrance Room	Walls	Grey Building Caulking	High	No	No	Good	Grey dirt matrix cement white PVC and fiberglass insulation.	Bulk	VS A-212	1-Jan-17												
	M 124	Entrance Room	Walls	Entrance Wall	High	No	No	Good	Grey dirt matrix cement white PVC and fiberglass insulation.	Bulk	VS A-212	1-Jan-17												
	M 124	Entrance Room	Entrance Room	Entrance Room	High	No	No	Good	Non-suspect doors.															
	M 124	Entrance Room	Doors	Non-Suspect Door	High	No	No	Good																
	M 124	Entrance Room	Doors	Non-Suspect Door	High	No	No	Good																
	M 124	Entrance Room	Doors	Non-Suspect Door	High	No	No	Good																
	M 124	Entrance Room	Doors	Non-Suspect Door	High	No	No	Good																
	M 124	Entrance Room	Doors	Non-Suspect Door	High	No	No	Good																
	M 124	Entrance Room	Doors	Non-Suspect Door	High	No	No	Good																
	M 124	Entrance Room	Doors	Non-Suspect Door	High	No	No	Good																
2nd Floor	M 125	Entrance Room	Walls	Grey Building Caulking	High	No	No	Good	Grey dirt matrix cement white PVC and fiberglass insulation.	Bulk	VS A-213	1-Jan-17												
	M 125	Entrance Room	Walls	Entrance Wall	High	No	No	Good	Grey dirt matrix cement white PVC and fiberglass insulation.	Bulk	VS A-213	1-Jan-17												
	M 125	Entrance Room	Entrance Room	Entrance Room	High	No	No	Good	Non-suspect doors.															
	M 125	Entrance Room	Doors	Non-Suspect Door	High	No	No	Good																
	M 125	Entrance Room	Doors	Non-Suspect Door	High	No	No	Good																
	M 125	Entrance Room	Doors	Non-Suspect Door	High	No	No	Good																
	M 125	Entrance Room	Doors	Non-Suspect Door	High	No	No	Good																
	M 125	Entrance Room	Doors	Non-Suspect Door	High	No	No	Good																
	M 125	Entrance Room	Doors	Non-Suspect Door	High	No	No	Good																
	M 125	Entrance Room	Doors	Non-Suspect Door	High	No	No	Good																
3rd Floor	M 126	Entrance Room	Walls	Grey Building Caulking	High	No	No	Good	Grey dirt matrix cement white PVC and fiberglass insulation.	Bulk	VS A-214	1-Jan-17												
	M 126	Entrance Room	Walls	Entrance Wall	High	No	No	Good	Grey dirt matrix cement white PVC and fiberglass insulation.	Bulk	VS A-214	1-Jan-17												
	M 126	Entrance Room	Entrance Room	Entrance Room	High	No	No	Good	Non-suspect doors.															
	M 126	Entrance Room	Doors	Non-Suspect Door	High	No	No	Good																
	M 126	Entrance Room	Doors	Non-Suspect Door	High	No	No	Good																
	M 126	Entrance Room	Doors	Non-Suspect Door	High	No	No	Good																
	M 126	Entrance Room	Doors	Non-Suspect Door	High	No	No	Good																
	M 126	Entrance Room	Doors	Non-Suspect Door	High	No	No	Good																
	M 126	Entrance Room	Doors	Non-Suspect Door	High	No	No	Good																
	M 126	Entrance Room	Doors	Non-Suspect Door	High	No	No	Good																
4th Floor	M 127	Entrance Room	Walls																					



APPENDIX D

Floor Plans



- NOTE(S)**
1. ASBESTOS IS A CARCINOGEN. DO NOT BREATHE ASBESTOS DUST.
 2. SAMPLES A-023, A-024, A-025, A-026, A-027, AND A-028 WERE COLLECTED ALONG THE EXTERIOR OF THE BUILDING.
 3. ASBESTOS-CONTAINING BLACK DOOR WINDOW CAULKING IS LOCATED ON THE EXTERIOR WINDOWS OF THE EXTERIOR DOORS OF ROOM 101.

- LEGEND**
- ASBESTOS - CONTAINING SAMPLE LOCATION
 - ASBESTOS - CONTAINING BLACK DOOR WINDOW CAULKING
 - NO ACCESS

REFERENCE(S)
PLAN OBTAINED FROM INFRASTRUCTURE SERVICES DEPARTMENT CITY OF SASKATOON. DATED BY 05/03/2013.

CLIENT
CITY OF SASKATOON

CONSULTANT

YYYY-MM-DD	2017-07-10
DESIGNED	KH
PREPARED	YAW
REVIEWED	KH
APPROVED	AG

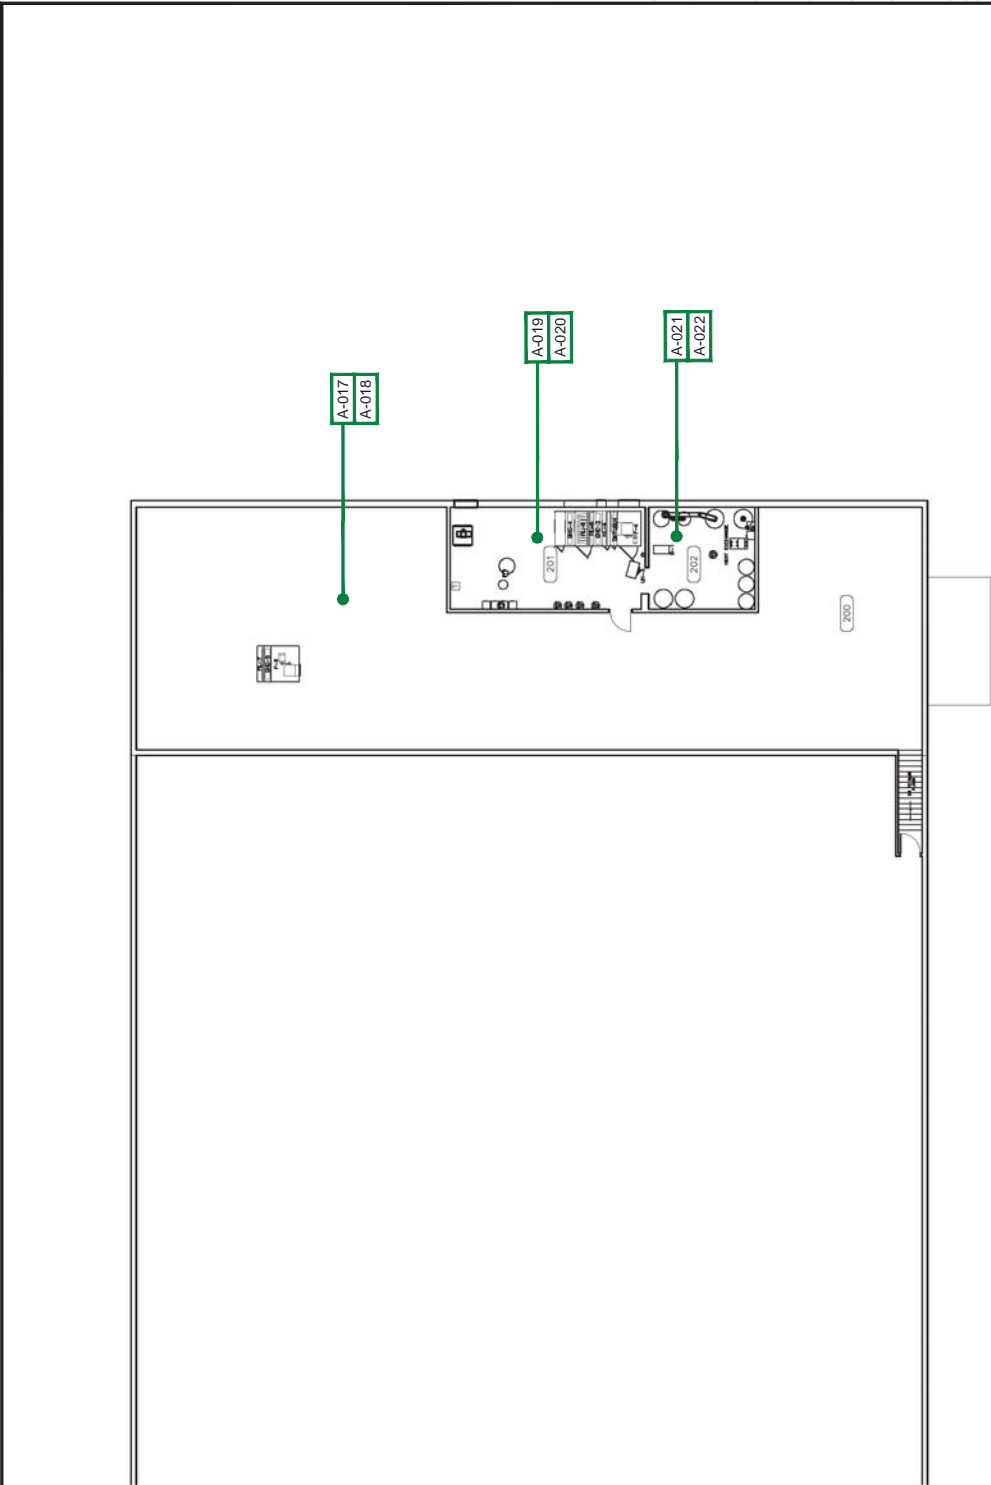


PROJECT
ASBESTOS ASSESSMENT
ARCHIBALD ARENA
1410 WINDSOR STREET

TITLE
MAIN FLOOR

PROJECT NO. 1667963
CONTROL 1000-HM-0001
REV. 0
FIGURE 1

SCHEMATIC ONLY, NOT TO SCALE



NOTE(S)

1. ASBESTOS IS A CARCINOGEN. DO NOT BREATHE ASBESTOS DUST.
2. SAMPLES A-023, A-024, A-025, A-026, A-027, AND A-028 WERE COLLECTED ALONG THE EXTERIOR OF THE BUILDING.
3. ASBESTOS-CONTAINING BLACK DOOR WINDOW CAULKING IS LOCATED ON THE EXTERIOR WINDOWS OF THE EXTERIOR DOORS OF ROOM 101.

LEGEND

 # ASBESTOS - CONTAINING SAMPLE LOCATION

REFERENCE(S)

PLAN OBTAINED FROM INFRASTRUCTURE SERVICES DEPARTMENT CITY OF SASKATOON, DATED BY 10/10/2012.

CLIENT
CITY OF SASKATOON

CONSULTANT

YYY-MM-DD 2017-07-10

DESIGNED KH

PREPARED YAW

REVIEWED KH

APPROVED AG



PROJECT
ASBESTOS ASSESSMENT
ARCHIBALD ARENA
1410 WINDSOR STREET

TITLE
MEZZANINE FLOOR

PROJECT NO. 1667963 **CONTROL** 1000-HM-0002 **REV.** 0 **FIGURE** 2

As a global, employee-owned organisation with over 50 years of experience, Golder Associates is driven by our purpose to engineer earth's development while preserving earth's integrity. We deliver solutions that help our clients achieve their sustainable development goals by providing a wide range of independent consulting, design and construction services in our specialist areas of earth, environment and energy.

For more information, visit golder.com

Africa	+ 27 11 254 4800
Asia	+ 86 21 6258 5522
Australasia	+ 61 3 8862 3500
Europe	+ 356 21 42 30 20
North America	+ 1 800 275 3281
South America	+ 56 2 2616 2000

solutions@golder.com
www.golder.com

Golder Associates Ltd.
16820 107 Avenue
Edmonton, Alberta, T5P 4C3
Canada
T: +1 (780) 483 3499

